
INSTALLATION DIAGRAM

The Greenwald Pay device installs into the machine control board

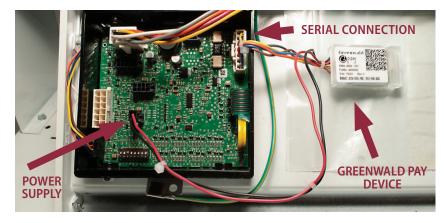

GREENWALD PAY DEVICE LED CODES

COLOR	ACTIVITY	SIGNIFICANCE
Off	Off	Device not connected to power
White	Slow Blink	Device not configured
Blue	Steady	Selected during configuration
Yellow	Slow Blink	Loading machine configuration
Green	Steady	Configured & ready
Blue	Slow Blink	Active with phone app
Green	Fast Blink	Active, Start not pressed
Green	Slow Blink	Busy, machine running
Red	Slow Blink	Machine Error
Red	Fast Blink	Machine Interface Error
Blue/Green	Slow Toggle	Firmware Loading
Red	Steady	Firmware Error

MACHINE ERROR CODES


ERROR CODE	SIGNIFICANCE	RESOLUTION
EC18 + EC19	No communication between	Check all wiring
	reader and control board	Check for proper setup (take note of Gpay LED colors)
EC11	Initialization error	Power down, power up and try again.
EC1A	Payment System initialization on Front End Control only system (aka 2019 setup on 2020 controller)	Change GMS machine configuration
EC05	Invalid data from reader	Check for correct machine type. Ensure the value in at least one of the programming options is not invalid and/or out of range.



Greenwald Pay Installation Instructions ACA Machines

Kit # 4004-101-3

No Power Supply INS. 2473-4 Rev B

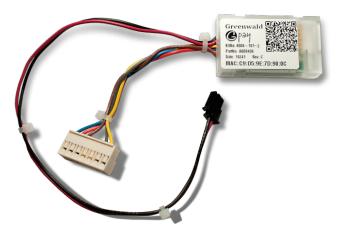

Tools Needed for Installation





Greenwald Industries

212 Middlesex Avenue | Chester, CT 06412 USA 800-221-0982 | www.greenwaldindustries.com



IMPORTANT: For seamless installation, set-up room and machine profiles in Greenwald Management System (GMS) prior to device installation. Check included instructions "INS.2486" prior to Greenwald Pay device

installation to determine if you have a Quantum Gold Pro Machine. Serial Payment System must be enabled on specified machines.

Disconnect power to machine.

Open console panel on machine.


Install serial communications connector from the Greenwald Pay device into the machine control board "H3".



If you have a Ouantum Gold Pro Machine (as determined in Step 1) Skip this step.

2

Ensure dip switch #3 is turned on. Leave all other switches in their original positions (change switch position only with power off).

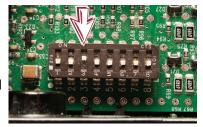

Leave console panel open and re-power the machine. After initialization, the Greenwald Pay device will slow blink white indicating device not configured and is ready to be paired with the profiles set up in GMS.

Connect Greenwald

Pay power plug

power "H10".

to machine board

6


Configure Machines

Login to the Greenwald Pay app using your admin credentials > Select "Setup".

4


Note: Machine Profiles must be configured in GMS, before you can pair the machines.



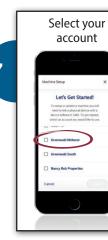

12



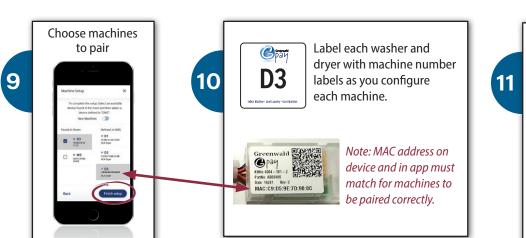



Close all machine console panels and the install is complete.

Call Greenwald Customer Service for additional help 800-221-0982

5

3